



sabena [®] B707	Module: MLG WW + DOORS	A/C Reg :	Check :	
	Oper. : RT-MP LC			
	Type : * ZONAL INSP*	Issuer : A59513	Cert.St.: 46928	11E0000500
Spec. : MECHANIC	Release Date: 28.11.2005		Page 1 of 3	

AD 94-10-06 rev 8913 LH MLG LOCK SUPP FITTING INSP

		MAINT	RII/INSP
Execution / Start Date:			
End Date:			

AD 94-10-06 rev 8913 LH MLG LOCK SUPP FITTING INSP

sabena B707	Module: MLG WW + DOORS	A/C Reg :	Check :	 11E0000500 Page 2 of 3
	Oper. : RT-MP LC			
	Type : * ZONAL INSP*	Issuer : A59513	Cert.St.: 46928	
	Spec. : MECHANIC	Release Date: 28.11.2005		

AD 94-10-06 rev 8913 LH MLG LOCK SUPP FITTING INSP


					MAINT	RII/INSP
Nr.	Hardtime	Task	Spec.	Related Documents		
1.		E3 E4 S	MEC	AD 94-10-06 rev 8913 MMS-328 533440 01000 rev 06.06.02 SB 53-2837 FIG1 rev 5		
Check: C						
Zones:						
Access:						
NRC YES <input type="radio"/> NO <input type="radio"/>		IF YES, NUMBER(S):				

LH MLG LOCK SUPPORT FITTING INSPECTION.

1. Open access panel from fillet rib to gain access to aft side of fitting.
2. Close visual inspection of all exposed surfaces of the fitting surface corrosion and cracks.
NOTE: IF CORROSION IS FOUND, EDDY CURRENT INSPECTION OF THE CORRODED AREA FOR CRACKS.


OK	NOT OK	DR N°

3. Apply BMS 3-23 on MLG lock support fitting.
4. Close access panel from fillet rib to gain access to aft side of fitting.

sabena [®] B707	Module: MLG WW + DOORS	A/C Reg :	Check :	 11E0000500
	Oper. : RT-MP LC	Issuer : A59513	Cert.St.: 46928	
	Type : * ZONAL INSP*	Release Date: 28.11.2005	Page 3 of 3	
Spec. : MECHANIC				

AD 94-10-06 rev 8913

LH MLG LOCK SUPP FITTING INSP

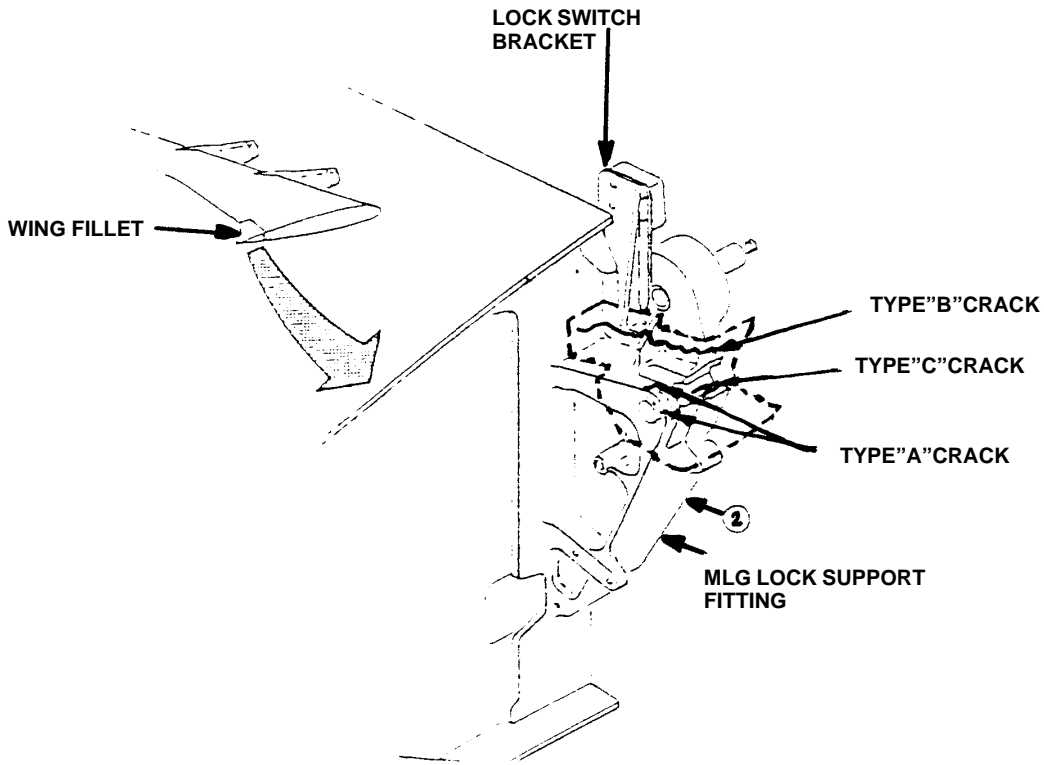

MAINT	RII/INSP
--------------	-----------------

AD 94-10-06 rev 8913

LH MLG LOCK SUPP FITTING INSP