



sabena [®] B707	Module: HOR STAB + FL CT	A/C Reg :	Check :	 61F4000500
	Oper. : RT-MP LC			
	Type : NDT INSP	Issuer : A59513	Cert.St.: 50516	Page 1 of 2
Spec. : NDT INSP	Release Date: 04.05.2011			

LH STAB UP & LOW CHORD INSP

Execution / Start Date:	
End Date:	

MAINT	RII/INSP


sabena B707	Module: HOR STAB + FL CT	A/C Reg :	Check :	 61F4000500 Page 2 of 2
	Oper. : RT-MP LC	Issuer : A59513	Cert.St.: 50516	
	Type : NDT INSP	Release Date: 04.05.2011		
Spec. : NDT INSP				

LH STAB UP & LOW CHORD INSP

					MAINT	RII/INSP
Nr.	Hardtime	Task	Spec.	Related Documents		
1.		E4	NDT	MMS-328 551150 01000 rev 30/10/08 SB 55-3381 rev 2 SB A3515 PART 5 PARA 5B TO 5F rev 0		
Check: B						
Zones: 391						
Access:						
NRC YES <input type="radio"/> NO <input type="radio"/>		IF YES, NUMBER(S):				

CHORD Inspection
LH HORIZONTAL STABILIZER REAR SPAR UPPER & LOWER CHORDS
FORWARD FLANGE SKIN NDT INSPECTION SS 13.179 TO SS 272.65.

LOW FREQUENCY EDDY CURRENT inspection for cracks between fasteners in FWD flange of upper & lower chords per SB A3515 fig 2 to fig 6.
 Ref to NDT doc D6-48023 part 6, 55-10-07 fig 8.

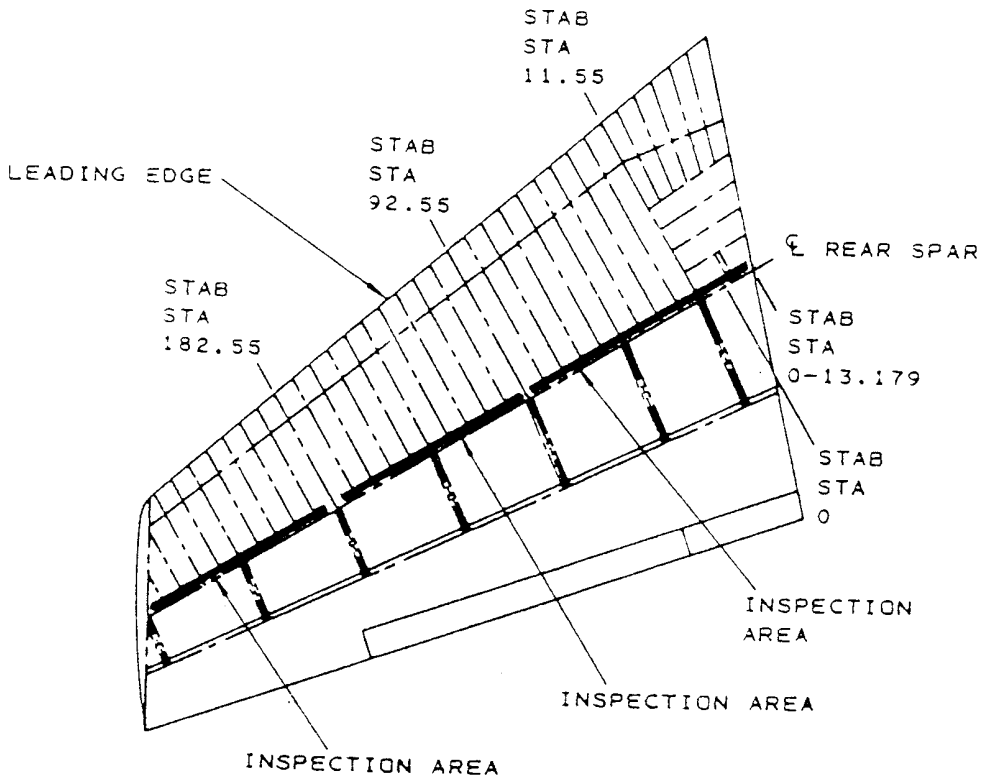

PLAN VIEW
HORIZONTAL STABILIZER